FEATURES

- Triplex plunger pump
- Nickel-Plated manifold
- New plunger guide bushing (patent pending)
- Solid ceramic plungers with dual guide system
- New optimized outlet valves
- Exclusive protection chamber between crankcase and manifold
- New dual lip oil seal



Triplex Plunger Pump, Solid Shaft, Nickel-Plated

SPECIFICATIONS

ESN2212S ESN2213S		ESN1810S	ESN2010S	ESN2012S	ESN2013S	
4.76 GPM 5.55 GPM		3.43 GPM	3.96 GPM	4.76 GPM	5.55 GPM	
3,045	5 PSI	4,000 PSI			3,625 PSI	
9.8 EBHP	11.5 EBHP	9.4 EBHP	10.9 EBHP	13.0 EBHP	13.6 EBHP	
1450	RPM	1750 RPM				
		Flooded to 70 PSI				
.866 in./22 mm		.709 in./18 mm	.787 in./20 mm			
.472 in./12 mm .512 in./13 mm		.394 in./10 mm		.472 in./12 mm	.512 in./13 mm	
22 oz. (.65 liters)						
165° F						
1/2"-14 BSP-F						
3/8"-19 BSP-F						
.945 in./24 mm						
21 lbs.						
10.4" x 8.8" x 5.4"						
	4.76 GPM 3,045 9.8 EBHP 1450 .866 in.	4.76 GPM 5.55 GPM 3,045 PSI 9.8 EBHP 11.5 EBHP 1450 RPM .866 in./22 mm	4.76 GPM 5.55 GPM 3.43 GPM 3,045 PSI 9.8 EBHP 11.5 EBHP 9.4 EBHP 1450 RPM Flooded t .866 in./22 mm .709 in./18 mm .472 in./12 mm .512 in./13 mm .394 in./ 22 oz. (.6 165 1/2"-14 3/8"-19 .945 in./ 21 I	4.76 GPM 5.55 GPM 3.43 GPM 3.96 GPM 3,045 PSI 4,000 PSI 9.8 EBHP 11.5 EBHP 9.4 EBHP 10.9 EBHP 1450 RPM 1750 Flooded to 70 PSI .866 in./22 mm .709 in./18 mm .472 in./12 mm .512 in./13 mm 22 oz. (.65 liters) 165° F 1/2"-14 BSP-F 3/8"-19 BSP-F .945 in./24 mm 21 lbs.	4.76 GPM 5.55 GPM 3.43 GPM 3.96 GPM 4.76 GPM 3,045 PSI 4,000 PSI 9.8 EBHP 11.5 EBHP 9.4 EBHP 10.9 EBHP 13.0 EBHP 1750 RPM Flooded to 70 PSI .866 in./22 mm .709 in./18 mm .787 in./20 mm .472 in./12 mm .472 in./1	







Instructions and Recommendations for the Installation of

ESN Series Pumps

Maximum temperature of the water through the pump is 165°F (73°C).

In order to obtain maximum performance in terms of duration of seals and valves, it is necessary to respect a few simple rules, as follows:

1) In order to avoid damage caused by cavitation, the pump must be pressure fed.

Note: Contact General Pump's technical sales department for guidance when operating the pump outside of the related inlet specs.

- 2) The plumbing which feeds the pump must be of a diameter at least equal to the inlet port. Also, follow the suggestions below:
 - a) Make the plumbing as short and straight as possible, preferably in an upward direction to facilitate the expulsion of eventual air bubbles naturally if compatible with the requirements of the system.
 - b) It is always useful to put a filter at the inlet with capacity of 4 to 5 times the flow of the pump, for example for a 4 gpm (15 l/min) pump, put a filter from 16 to 20 gpm (60-75 l/mi)The mesh size suitable for this application is 0.016" (.4 mm).
 - c) It is extremely important to put a pressure switch on the suction port of the pump, and in any case downstream from the filter, so that it can stop the pump should the feed pressure drop by 20% due to the filter clogging or failure of the feed pump, etc.

3) Change of oil

We recommend the *first oil change after the first 50 hours*, with the *pump stopped* and the *oil still warm*.

This change is not recommended because the oil has lost its properties, but rather to eliminate the impurities that have gotten into the oil during the running-in phase. If these impurities are not removed, but are allowed to remain in the oil, they may cause premature wear to the moving parts and the oil seals. After this initial change, the oil can then be changed every three months or 300 hours of operation thereafter.


Please note: If the pump works in conditions with high humidity and with sharp temperature changes, it is possible that condensation will appear inside the crankcase, which mixing with the oil can change its properties. This is easy to see because the oil changes to a white, milky color.

If the pump does not have excessive water leaking from the packings, and the oil becomes milky, the oil has to be changed more frequently. The percentage of water in the oil must not exceed 20%.

Use oil per the following chart:

CHART OF COMPATIBLE OILS					
General Pump	Series 100				
BP	VISCO 2000				
CASTROL	CWX				
MOBIL	SUPER				
SHELL	HELIX SUPER				
TOTAL	QUARTZ 4000-5000				

ESN Series Solid Shaft, Nickel-Plated Manifold

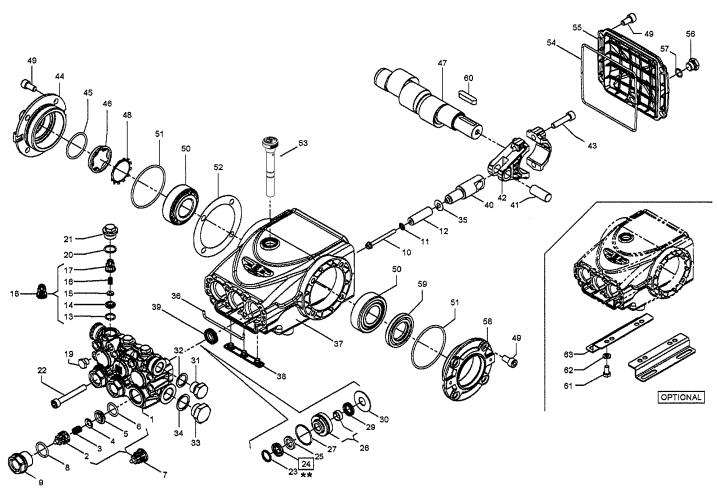

PA	RTS LIS	ST .									
ITEM		DESCRIPTION	QTY	ITEM	PART NO.	DESCRIPTION	QTY	ITEM	PART NO.	DESCRIPTION	QTY
1.	59121241	Manifold, Ø 18	1	24.	90269100	Packing, Ø 20, HP	3	44.	47151222	Crankcase Cover, Side	1
	59121341	Manifold, Ø 20	1		90271600	Packing, Ø 22, HP	3	45.	90387700	O-ring, Ø 39.34x2.62	1
	59121441	Manifold, Ø 22	1		90265350	Packing, Ø 18, HP	3	46.	70211801	Sight Glass	1
2.	36202551	Valve Cage	3	25.	90511150	Anti-ext. Ring, Ø 18	3	47.	59020135	Crankshaft	1
3.	94767600	Spring, Ø 9.4x14.8	3		90513400	Anti-ext. Ring, Ø 20	3			(ESN2013S, ESN2213S)	
4.	36200176	Valve, Spherical	3		90514850	Anti-ext. Ring, Ø 22	3		59020235	Crankshaft	1
5.	36200366	Valve Seat, Inlet	3	26.	59606001	Intermed. Ring, Ø 18	3			(ESN2012S, ESN2212S)	
6.	701115	O-ring, Ø17.13v2.62	3		59606101	Intermed. Ring, Ø 20	3		59020335	Crankshaft,	1
7.	36711501	Valve Assembly	3		59606201	Intermed. Ring, Ø 22	3			(ESN1810S, ESN2010S)	
8.	701002	O-ring, Ø20.24x2.62	3	27.	90361200	O-ring, 31.47x1.78	3	48.	90075600	Retaining Clip	2
9.	98222500	Valve Cap, M24x1.5x16.7	3	29.	90269000	Seal, Ø 20, LP	3	49.	99303900	Screw, M8x16	12
10.	99169000	Plunger Bolt, M5x55	3		90271500	Seal, Ø 22, LP	3	50.	640047	Tapered Roller Bearing	2
11.	96690500	Washer, Ø 5x11.5x0.4	3		90265000	Seal, Ø 18 LP	3	51.	90391300	O-ring, Ø 67.95x2.62	2
12.	58040209	Plunger, Ø 18x42	3	30.	59210770	Support Ring, Ø 18	3	52.	97568000	Shim, 0.3 mm	1
	59040009	Plunger, Ø 20x42	3		59210870	Support Ring, Ø 20	3		97597800	Shim, 0.1 mm	1
	59040109	Plunger, Ø 22x42	3		59210970	Support Ring, Ø 22	3	53.	98211300	Oil Dipstick	1
13.	701014	O-ring, Ø 12.42x1.78	3	31.	98209900	Plug, 3/8"x13, Nickel	1	54	90392200	O-ring, Ø133.02x2.62	1
14.	36211366	Outlet Valve Seat	3	32.	96738000	Gasket, 17.5x23x1.5	1	55.	59160022	Rear Cover	1
15.	36211276	Outlet Valve Poppet	3	33.	98217900	Plug, 1/2" BSPx10, Nickel	1	56.	98204250	Plug, 1/4"x9	1
16. 17.	94733300	Spring, Ø 6.2x10.4	3	34.	96751400	Gasket, Ø 21.5x27x1.5	1	57.	701013	O-ring, Ø 10.82x1.78	1
17.	36211151	Outlet Valve Cage Guide	3	35.	96699000	Washer, Ø 7.5x23x0.5	3	58.	47151022	Side Cover	1
18.	36719301	Complete Outlet Valve	3	36.	59211082	Gasket, Ø 3x103	1	59.	90164800	Oil Seal, Ø 30x55x7	1
19.	98196700	Plug, Nickel	3	37.	59010022	Crankcase	1	60.	91489200	Key	1
20.	701016	O-ring, Ø 15.6x1.78	3	38.	58210451	Drip Cover	1	61.	99303700	Screw, M8x16	4
21.	98213750	Valve Cap, M18x1.5x10	3	39.	90156550	Oil Seal, Ø 15x24x5.7	3	62.	96701600	Washer, Ø 8.4	4
22.	99317500	Screw, M8x60	8	40.	59050066	Piston Guide	3	63.	50200074	Pump Foot	2
23.	66100751	Head Ring, Ø 20	3	41.	97739900	Piston Pin, Ø 14x34	3				
	66100951	Head Ring, Ø 22	3	42.	59030001	Connecting Rod	3				
	63101051	Head Ring, Ø 18	3	43.	99309900	Connecting Rod Screw	6				


REPAIR KITS

KIT NO.	K269	K270	K270 K271	Ø 18		Ø 20		Ø 22	
MI NO.	17209	KZ70		K284	K289	K285	K290	K286	K291
ITEM NO'S INCLUDED IN KIT	2, 3, 4, 5, 6, 13, 14, 15, 16, 17, (7), (18)	8, 9, 20, 21	39	23, 24, 25, 27, 29	23, 24, 25, 26, 27, 29, 30	23, 24, 25, 27, 29	23, 24, 25, 26, 27, 29, 30	23, 24, 25, 27, 29	23, 24 25, 26 27, 29 30
NUMBER OF ASSY'S IN KIT	6	6	3	3	1	3	1	3	1
NO. OF CYLINDERS KIT SERVICES	3	3	3	3	1	3	1	3	1

TURQUE SPECS							
	1	Y					
Position	FtLbs.	Nm.					
9	96	130					
10	4.5	6					
19*	9.6	13					
21	44.3	60					
22	14.8	20					
31	30	40					
33	30	40					
43	14.8	20					
49	14.8	20					
56	14.8	20					
61	14.8	20					

^{*}Use Loctite 542 Red

DIMENSIONS

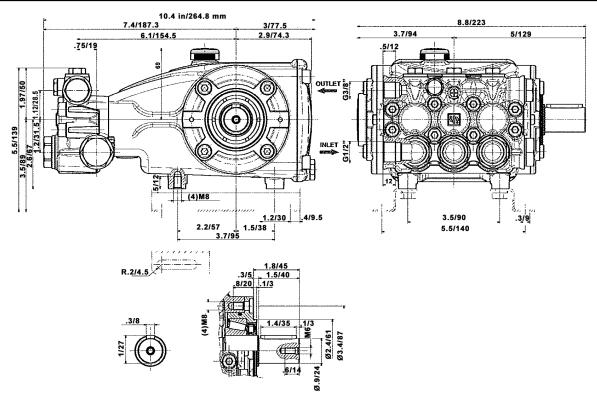

WARNING: High Pressure Systems require a primary pressure regulating device (i.e. regulator, unloader) and a secondary pressure relief device (i.e. pop-off valve, relief valve). Failure to install such relief devices properly could result in personal injury or damage to pump or property. GP does not assume any liability or responsibility for the operation of the user's high pressure system.



WARNING: This product can expose you to chemicals including lead, which is know to the state of California to cause cancer and birth defects or other reproductive harm. For more information, go to www.P65Warnings.ca.gov

