
- Up to a 20% injection draw rate
- Available with both fixed and adjustable barbs
- Made in the USA
- A cost effective solution to your chemical application needs
- Features a ceramic check ball suitable for acid applications





### **SPECIFICATIONS**


OI LOII I									
Model		100947	100948	100949	100950	100827	100828	100829	100830
Style		Fixed				Adjustable			
Operating Pressure		4500 PSI							
Flow Range		1-2 GPM	2-3 GPM	3-5 GPM	5-8 GPM	1-2 GPM	2-3 GPM	3-5 GPM	5-8 GPM
Port Sizes	Inlet:	3/8" NPT-M							
	Outlet:	3/8" NPT-M							
	Chemical Port:	1/4" Hose Barb							
Max Temp		190° F							
Dimensions		2.2" x 1.15" 1.9"				2.2" x 1.15" x 2.83"			
Weight		.2 lb.							
Materials		Brass, Stainless Steel, Viton, Ceramic							

### **DIMENSIONS**

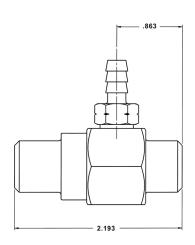

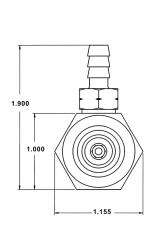

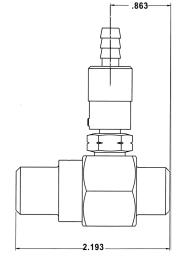

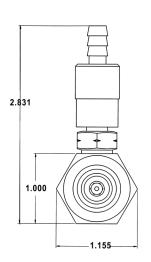







# Hi-Draw Injectors

## GENERAL PUMP A member of the Interpump Group

#### INSTALLATION


This product is to be used with clean, fresh water. For different or corrosive liquids, contact GP Technical Service Department. With not clean liquids, appropriate filtration should be installed. Select the injector based on the nominal operating rating: system rated pressure, max flow and max temperature. Install valve with direction arrow pointing downstream. For proper operation a control device such as a dual lance wand, quick couple nozzles, or an adjustable nozzle holder must be used to lower the system pressure at the nozzle.

Under no circumstances should the pressure of the system exceed the maximum rated pressure of any component.

### **TROUBLESHOOTING**

PROBLEM	CAUSE	SOLUTION
Injector will not draw liquid	Incorrect nozzle System is not in low pressure mode	Check and change nozzle Change or adjust nozzle to put system in low pressure mode
Injector will not draw liquid	Discharge hose is too long	Reduce length of discharge hose or
	Chemical line is clogged	change injector* Clear chemical line of obstruction
Rate of draw seems too slow	Discharge hose is too long  Air leak in chemical line Chemical is too viscous	Reduce length of discharge hose or change injector* Locate and repair leak Reduce chemical with water to decrease its viscosity
Chemical injector is leaking from hose barb	Obstruction in hose barb checkvalve  Damaged o-ring in checkvalve	Disassemble and remove obstruction  Remove and replace o-ring
Excessive pressure load on pump, motor or engine	Clogged injector Improperly sized injector orifice	Clear injector orifice of obstruction Change orifice*
	*Contact GP Technical Service for Assistance	ce

### **PARTS LIST**

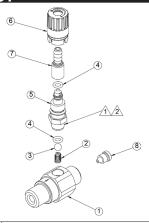

Apply Loc-tite® 545 to threads for re-assembly





Item	Part Number	Description	QTY.
KIT *	100804	Repair Kit	1
1	501340	Housing, Injector	1
2*	720049	Spring	1
3*	640065	Ball, 1/4", Ceramic	1
4*	701501	O-ring, 70 Duro, Viton, .208x.070	1
5	510341	Hose Barb, Brass	1
6	520147	Nozzle, .057 in., 303SS (100947)	
	520116	Nozzle, .070, 303 SS (100948)	1
	520115	Nozzle, .083, 303 SS (100949)	1
	520127	Nozzle, .091, 303 SS (100950)	1

5/1/2

